INSTALLATION INSTRUCTIONS FOR 776-301

WARNING! SHUT OFF THE POWER AT FUSE OR CIRCUIT BREAKER.

ASSEMBLY THE FIXTURE

ASSEMBLY THE FIXTURE (Fig.1)

1. Carefully unpack your new fixture and lay out all the parts on a clear area. Take care not to lose any small parts necessary for installation.
2. Thread the Center stem (A) into the hex coupling (B) Thread until snug.
3. Place top center column (C), Steel tube (D), Check ring (E), Plate cap (F), Arm fixed column (G), top plate cap (H), metal leave (I) and Spacer (J) onto the Center stem (A) in turns. (See Fig.1), Secured the top column section by thread the knurled nut (K) from the top of the center stem (A).
4. Thread the Loop (L) onto the top of the center stem (A). Thread until snug.
5. Attach the top arm (Y) onto the center top column assembly by through the square pin (N) into the bottom hole of the arm (Y). Thread the ball screw (M) through the hole on the top of the arm and connect the arm to center column by thread the ball screw till tight. The top column assembly was completed.
6. Spread the 6 arms (O) to evenly position. Attach the arm on to the lower center column by using the ball screw (P). Thread until snug.
7. Thread the bottom center stem (Q) into the bottom hex coupling (X), Thread and tighten by the hex nut (Y).
8. Place the bottom column (R) onto the center stem (Q). Thread the finial (S) onto the bottom stem, Thread until snug.
9. Place the Candle sleeve (U) onto the socket (T). Install the correct type and wattage of bulb as the wattage label on the sleeve shows. Clip the Fabric shade (V) onto the bulb.
10. Hang the crystal drops (W) to the front edge of the metal leave of each arm.

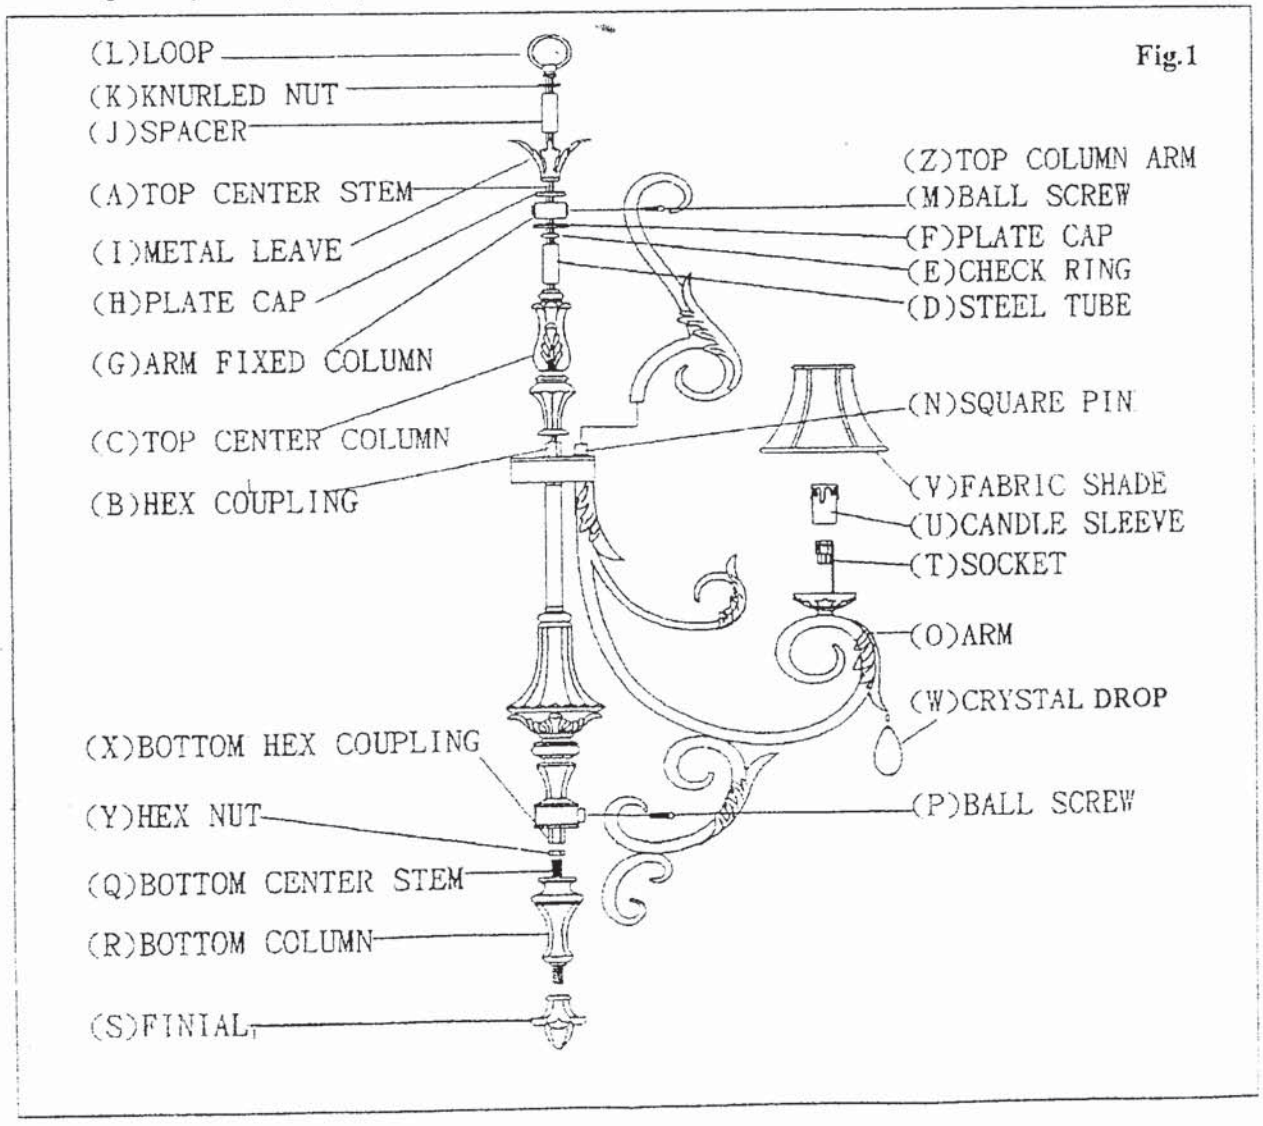

Fig.1

HANGING THE FIXTURE (Fig.3)

1. Shut off the power at the circuit breaker and remove old fixture from the ceiling, including the old cross bar.
2. Carefully unpack the new fixture and lay all the parts on a clear surface.
3. Thread the nipple (C) into loop (F) until snug.
4. Thread other end of nipple (C) with loop attached into crossbar (D) until snug.
5. Place lock washer (B) over end of nipple protruding through crossbar and thread hex nut (A) onto nipple until tight.
6. Take this crossbar assembly and mount to ceiling junction box with junction box screw (E). Tighten screws securely with screwdriver. This side of crossbar marked with "GND" must face out.
7. Use a pair of pliers to open one end link of the chain and connect to the fixture loop (J). Close the link.
8. By measuring, determine correct number of links needed for proper hanging height. Using pliers, Disconnect and discard remaining chain.
9. Lace the fixture wires through the chain.
10. Slip loop collar (H) over the chain, then do the same with canopy (G).
11. Open the other end link of the chain and connect to the ceiling loop (F). Close the link.
12. Feed the fixture wires through the loop (F) and nipple (C) and pull until taut.

CONNECTING THE WIRE (See fig.2)

1. Take the black wire from the ceiling junction box and the smooth wire legs from the fixture and twist bare ends together. Twist wire connector onto end of wire until snug.
2. Repeat same process with white junction box wire and ribbed wire legs of fixture wire. NOTE :Twist wire together in the same direction you twist the wire connector onto wire.
3. If your junction box has a grounding wire (Green or bare copper), Attach this wire and the bare copper wire from the fixture together as step 1. If junction box has no ground wire. Attach the bare copper fixture wire to the green ground screw on the cross bar.
4. Tuck these wires connectors neatly into the ceiling out let box and raise the loop (H) and thread onto ceiling loop protruding through canopy.

Your installation is now complete. Return power to the junction box and test the fixture

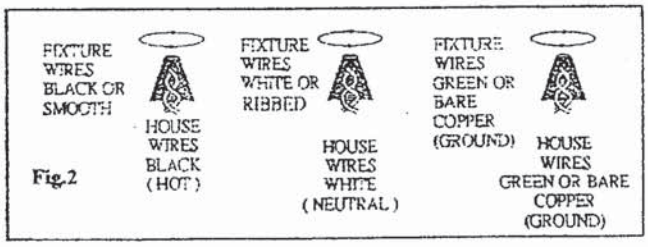

Fig.2

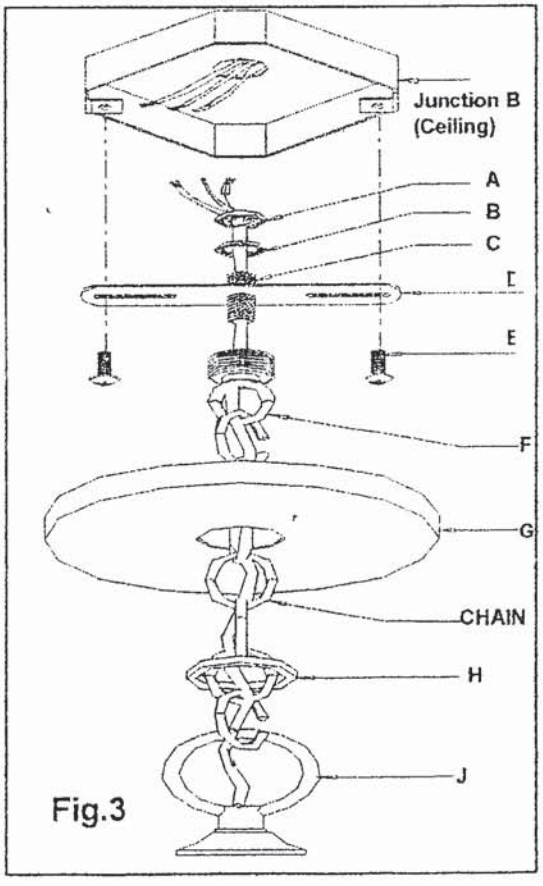

Fig.3

american lighting association

UL Listed